


1926.1410 Power Line Safety (all voltages)


Equipment Operations Closer Than Table A Zone

- Intentionally Working Closer Than Table A Zone

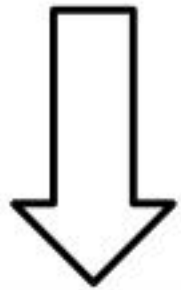

Must Show:

- Staying Outside Zone is Infeasible
- Infeasible to Deenergize and Ground or relocate



At A Min. - All of the Following Are Required:

1. PL owner or **RPE** sets min approach distance
2. Planning meeting – procedures
3. Deactivate automatic re-energizer
4. **Dedicated Spotter**
5. Elevated warning line or barricade
6. Insulating link, or Guarded – (Example of Guarded: Insulated gloves)
7. Non-conductive rigging
8. Range limiter (if equipped)
9. Non-conductive tag line (if used)
10. Barricades 10 feet from equipment
11. Limit access to essential employees
12. Ground crane
13. Insulating line hose or cover-up
14. PL owner or **RPE**, EO & crew to review the plan
15. PL owner or **RPE** & employers shall select a plan director
16. Assess the plan during its use
17. Must comply w/manufactures guidelines (1415-1416)
18. Train the operator and crew according to 1408(g), 1430(g)

Procedures that must be covered during the planning meeting